



Dart Hawkesbury
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200

D117-762-041
Job Sheet 167191-C



Part No: D117-762-041

Job Qty: 1 ea

Part Name: Replacement Skidtube



Part Weight: 0 lbs

Status: Scheduled

Priority: Medium

Job Created: 10/26/17

Job Tracking No:

Due Date: 12/11/17

Created By: Victoria Michaud-Febrille

Type: SOLD

Description:

Note: SALES ORDER 658

Ship Via:

Bill of Materials

Job Routing

Op No	Operation	Qty	Start Date	Due Date	Standard	Workcenter/Supplier		Sign-off
					Setup hrs	Run Hrs	Lead Time	
90	Start up Operation	1 Ea	12/8/17	12/8/17	0.00	0.00	Start Up Skidtubes	
130	Skidtubes	1 pcs	12/8/17	12/8/17	0.00	3.47	Skidtubes	AP
140	Skidtubes	1 pcs	12/9/17	12/9/17	0.00	3.47	Skidtubes	BE 17-11-13
150	QC	1 pcs	12/9/17	12/9/17	0.00	0.00	QC10	BE 17-11-13
160	QC	1 pcs	12/9/17	12/9/17	0.00	0.00	QC5	BE 2017/11/14
170	HandFinish	1 pcs	12/9/17	12/9/17	0.00	0.97	HandFinish1	BE 2017/11/14
180	QC	1 pcs	12/9/17	12/9/17	0.00	0.00	QC7	BE 2017/11/14
190	Skidtubes	1 pcs	12/9/17	12/9/17	0.00	3.47	Skidtubes	BE 2017/11/14
200	QC	1 pcs	12/9/17	12/9/17	0.00	0.00	QC10	BE 2017/11/14
210	QC	1 pcs	12/9/17	12/9/17	0.00	0.00	QC5	BE 2017/11/14
215	HandFinish	1 pcs	12/9/17	12/9/17	0.00	0.97	HandFinish2	BE 2017/11/14
220	Powdercoat	1 pcs	12/9/17	12/9/17	0.00	0.26	Powdercoat1	BE 2017/11/14
230	QC	1 pcs	12/9/17	12/9/17	0.00	0.00	QC3	BE 2017/11/14
250	HandFinish	1 pcs	12/11/17	12/11/17	0.00	0.97	HandFinish4	BE 2017/11/14
260	QC	1 pcs	12/11/17	12/11/17	0.00	0.00	QC5	BE 2017/11/14
265	DC	1 pcs	12/11/17	12/11/17	0.00	0.00	DC	BE 2017/11/14
270	Packaging	1 pcs	12/11/17	12/11/17	0.00	0.00	Packaging3	BE 2017/11/14
280	QC21-FG	1 Ea	12/11/17	12/11/17	0.00	0.00	QC21	BE 2017/11/14

Part Op 130 - 1-Cut Aft end using DT8185 2-Deburr ends 3-Drill Aft Cap holes using DT8678 *** OPEN AFT CAP HOLE TO .187"

Descriptions: *** 4-Locate DT 8973 from aft cap holes & Drill Ground wire hole on top of Tube. 5-Install 3/16 cleco in Ground wire hole ,then drill all X-Bolt holes using 3/16" drill. 6-Drill pilot holes for wearplates using DT8900 7-Open wearplate holes to Ø19/64" (0.297") as per Dwg D3582. 8-Drill holes for D5520-1 doubler using DT10309 A & B, locating from 4th and 5th crossbolt holes from aft using .1875 clekos. Spot drill tube using #20 drill (note 10). Remove DT10309 B. Re-install DT 10309 A drill thru tube and doubler using #20 drill (note 10), cleko as you go. Remove .1875 clekos and open holes in tube and doubler to 0.750". Remove doublers and identify orientation. 9-Deburr doubler and doubler holes in skid tube. 10-Countersink doubler holes in skid tube as per Dwg. detail J and note 12 -Touch up alodine on D5520-1 doublers. 11-open ground wear holes to 0.391" as per section B-B 12-Open Aft Cap holes using .209" drill. 13-Drill pilot holes for section D-D and E-E. Holes must be laid out by hand. Mark out Center line and make sure that 6.65 and 5.906 measurements are respected. Double check before drilling, do not open holes to finish size, 12-Do not open holes of section G-G to finishes size.

140 - 1-Weld fwd cap D2964 per dwg D3582 and QSI 004 A/R AL ROD Batch: 134133 2-Grind flush

190 - ***MASK OFF HOLES OF SECTION F-F (DO NOT C/SINK) 1-Open X-Bolt holes to finish size as per Dwg D3582, sections D-D, E-E, G-G as per Dwg. 2-Counter Sink X-BOLT holes as per Dwg D3582 D-D, E-E and G-G.***Do NOT countersink holes of section F-F). 3-Deburr and blow out chips from inside of tube, prep. tube for welding. 4-Install doublers using DT10309 B. Shave rivets as required. 5-Bond web as per Dwg D3582 & QSI 015 AVR 241 Sike Flex Batch: 138654 Exp Date: 2018-07-31 6- Swage x-bolt spacer as per dwg and Section F-F QSI002.

DQA: _____ Date: _____

QA Closed: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE

Work Order update only



Work Order: _____

Part No. _____

NCR No. _____

Date: _____

Dart Aerospace Ltd.
1270 Aberdeen Street
Hawkesbury, ON K64 1K7
CANADA
TEL.: 1 613 632-5200
Email: sales@dartaero.com
www.dartaerospace.com

DISPOSITION

Rework ☐
Scrap ☐

AGAINST DEPARTMENT/PROCESS

Skid-tube	☐	Cross tube	☐	Water Jet	☐	Engineering	☐
Machining	☐	Small Fab	☐	Prod. Eng. Coord.	☐	Quality	☐
Thermoforming	☐	Finishing	☐	Rec/Store/Packaging	☐	Other	☐
Large Fab	☐	Composite	☐	Supplier	☐		☐

QTY Effective: _____

MRB (QS1042) Approval

Disposition

Completed By

Lead hand / Supervisor
Approval Verification

QC / QA Coordinator
Approval

FAULT CATEGORY

Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong	☐
Set-up	☐	Folio/Program	☐	Outside Dimensions	☐
BOM/Route	☐	Grain	☐	Over/Under tolerance	☐
Broken/Damage/Defect	☐	Weld	☐	Part Incorrect	☐
Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing	☐
Contamination	☐	Out of Sequence	☐	Part Moved	☐
Countersink	☐	Off-set	☐	Drawing	☐
Cut Too Short	☐	Mislabeled	☐	Finish	☐
Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread	☐
Drill Holes	☐	Misaligned/off center	☐	Turning Sequence	☐

DART
AEROSPACE
S009069

Replacement Skidtube

PART NO: D117-762-041
Revision:
Operation: Start up Operation
Change No:

Mfg Date: 11/13/17
Job No: 167191-C

Past Expiry Date ☐
Misidentified ☐
Past Due ☐

OTHER: ☐

7-Weld x-bolt spacers as per Dwg D3582 section D-D, E-E and G-G. A/R AL ROD Batch: M136168 8-Grind welds flush

215 - Touch-up alodine as per QSI

220 - START TIME 2:35 OVEN TEMPERATURE: 320° FINISH TIME: 3:05 M138467

250 - 1-Inspect for Foreign objects 2-Install Aft cap as per Dwg D3582, Detail "C" A/R 241 Sika Flex

Batch: _____ Exp Date: _____ 3-Install Wearplates as per Dwg D3582, Note: Install Bolt and washer on Ground Wire inserts on top of tube see section D-D of dwg D3582 *****Do not install bolts where indicated on Dwg(Note #6)***** 4- Wing Walk as per Dwg D3582 and QSI 005 4.4

265 - Photocopy bluefile & type labels per PPP D117-762-041 CHG002

270 - Identify and pack for shipping as per PPP D117-762-041 Location :FG081

Job Allocations

Operation	Component Part	Required	Inventory	Allocated	Std Qty
90-Start up Operation <u>S007117</u>	D3582-1-BENT <u>167200</u>	1	3	0	0
140-Skidtubes	D2964 <u>166478</u>	1	9	0	0
190-Skidtubes <u>M138325x23</u>	CR3212-5-05	68	536	0	0
<u>CR3212-5-5</u>	D2971 <u>F155918</u>	1	24	0	0
<u>FM137587-2x45</u>	D3584-1 <u>163674</u>	1	8	0	0
	D3662-1 <u>F163443</u>	3	49	0	0
	D3662-3 <u>F163443</u>	1	55	0	0
<u>S005228 -</u>	D5304-1 <u>F163443</u>	2	3	0	0
	D5520-1 <u>164764</u>	2	16	0	0
250-HandFinish	ALS4-1032-130 <u>S007274</u>	36	1,675	0	0
<u>FM137054-0</u>	ALS4-428-165	2	47	0	0
<u>FM138207-40</u>	AN3C4A <u>S000583</u>	28	1,803	0	0
	AN4-4A	2	19	0	0
	D2965 <u>F127852</u>	1	15	0	0
	D3508-11 <u>S007589</u>	1	4	0	0
	D3508-13 <u>F163286</u>	1	10	0	0
	D3508-3 <u>F163732</u>	1	13	0	0
	D3508-9 <u>F163738</u>	1	10	0	0
	D3558-11 <u>F165221</u>	1	10	0	0
	D3558-13 <u>S018528</u>	1	9	0	0
	D3558-3 <u>S009873</u>	1	6	0	0
	D3558-9 <u>M165222-02</u>	1	15	0	0
<u>FM138409-1</u> →	NAS1149C0332R	28	5,020	0	0
	NAS1149D0332J <u>S01581</u>	2	1,512	0	0
	NAS1149D0416J	2	2,976	0	0
	<u>F1131511</u>				

Part Specifications

Specifications could not be found.

Plex 10/26/17 11:29 AM dart.Michaud-Febrille.Victoria

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date : _____		Step #: _____		QTY Effective : _____			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐		OTHER : _____					

ITEM	Qty -041	Part Number	Description
	X	D3582-041	SKIDTUBE ASSEMBLY
1	1	D2962-150	EXTRUSION
2	1	D2964	CAP
3	1	D2965	CAP
4	1	D2971	CROSS BOLT SPACER
5	1	D3508-3	WEARPLATE
6	1	D3508-9	WEARPLATE
7	1	D3508-11	WEARPLATE
8	1	D3508-13	WEARPLATE
9	1	D3558-3	GASKET
10	1	D3558-9	GASKET
11	1	D3558-11	GASKET
12	1	D3558-13	GASKET
13	1	D3584-1	WEB
14	3	D3662-1	CROSS BOLT SPACER
15	1	D3662-3	CROSS BOLT SPACER
16	2	D5304-1	CROSS BOLT SPACER
17	2	D5520-1	DOUBLER
18	28	AN3C4A	BOLT
19	2	AN3-5A	BOLT
20	2	AN4-4A	BOLT
21	28	NAS1149C0332R	WASHER (AN960C10L)
22	2	NAS1149D0332J	WASHER (AN960JD10L)
23	2	NAS1149D0416J	WASHER (AN960JD416L)
24	36	AELS-1032-130	INSERT
25	2	ALS7-428-165	INSERT
26	88	CR3212-5-05	CSK RIVET, CHERRY MAX

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: CHEMICAL CONVERSION COAT PER QSI 005 4.1 PRIOR TO INSERTING D3584-1 WEB.
POWDER COAT ASSEMBLY GLOSS WHITE (REF 4.3.5.1) PER DART QSI 005 4.3.
ANTI-SKID PAINT AS INDICATED TO 1.00 ABOVE CENTER LINE PER DART QSI 005 4.4
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: N/A
- 7) WEIGHT: 18.2 lbs
- 8) WELDING: PER DART QSI 004.
- 9) INSERT D3584-1 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241/291 ADHESIVE PER DART QSI 015 AFTER BENDING.
- 10) USE DART DRILL TEMPLATE DT8900 TO LOCATE AND DRILL Ø0.297 HOLES (36 PLACES) FOR WEARSHOE INSERTS. INSTALL AELS-1032-130 PER SECTION G-G (36 PLACES) AFTER FINISH. SEAL WEARPLATE BOLTS WITH SIKAFLEX-241/291.
- 11) DO NOT INSTALL AN3C4A BOLTS AND NAS1149C0332R WASHERS IN INDICATED LOCATIONS
- 12) LOCATE QTY (34) HOLES ONTO THE SKIDTUBE PER D5520-1 DOUBLER AND DRILL Ø0.161 THRU SKIDTUBE AND DOUBLER USING DT10309. COUNTERSINK Ø0.286 x 100° (34 PL) PER DOUBLER AND INSTALL EACH D5520-1 DOUBLER USING QTY (34) CR3212-5-05 CSK RIVETS.

RELEASED
2017-08-11
KEN 17-547

E	MOVE VIEWS FROM SHT 1 TO SHT 2. ADD ITEMS 17 & 26 AND NOTE 12-13. Ø0.187 HOLE WAS Ø0.75. ADD SHT 3, ADD DETAIL J. SECTION F-F ADD D5520-1. SCALE ON VIEWS WAS 3X.	AJS	17.03.27
D	D5304-1 WAS D2973; REVISE BOM & SECTION F-F & SECTION NOTES (ZN B7-3, A8-3); REF NCR16-6160	RF	17.01.09
C	D3492 PLUG ASSEMBLIES REMOVED. REFORMAT NOTES SHT 1	AP	15.11.02
B	29.86 WAS 29.87 (ZN C2-1), INCORPORATED DEO D3582-A-1 (ZN D5-1). FORMAT TO CURRENT STD	RF	15.02.20
A	NEW ISSUE	PH	07.06.08
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE USA, INC EUGENE, OR	
DRAWN	AJS		
CHECKED		DRAWING NO.	REV. E
MFG. APPR.		D3582	SHEET 1 OF 4
APPROVED		TITLE	SCALE
DE APPR.		BK 117 SKIDTUBE ASSEMBLY	NTS
DATE	17.03.27	COPYRIGHT © 2007 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																						
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																						
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																						
Large Fab ☐	Composite ☐	Supplier ☐																							
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																		
Description Work Order Deviation				Disposition				Completed By																	
Root Cause		FAULT CATEGORY																							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	OTHER : ☐																			

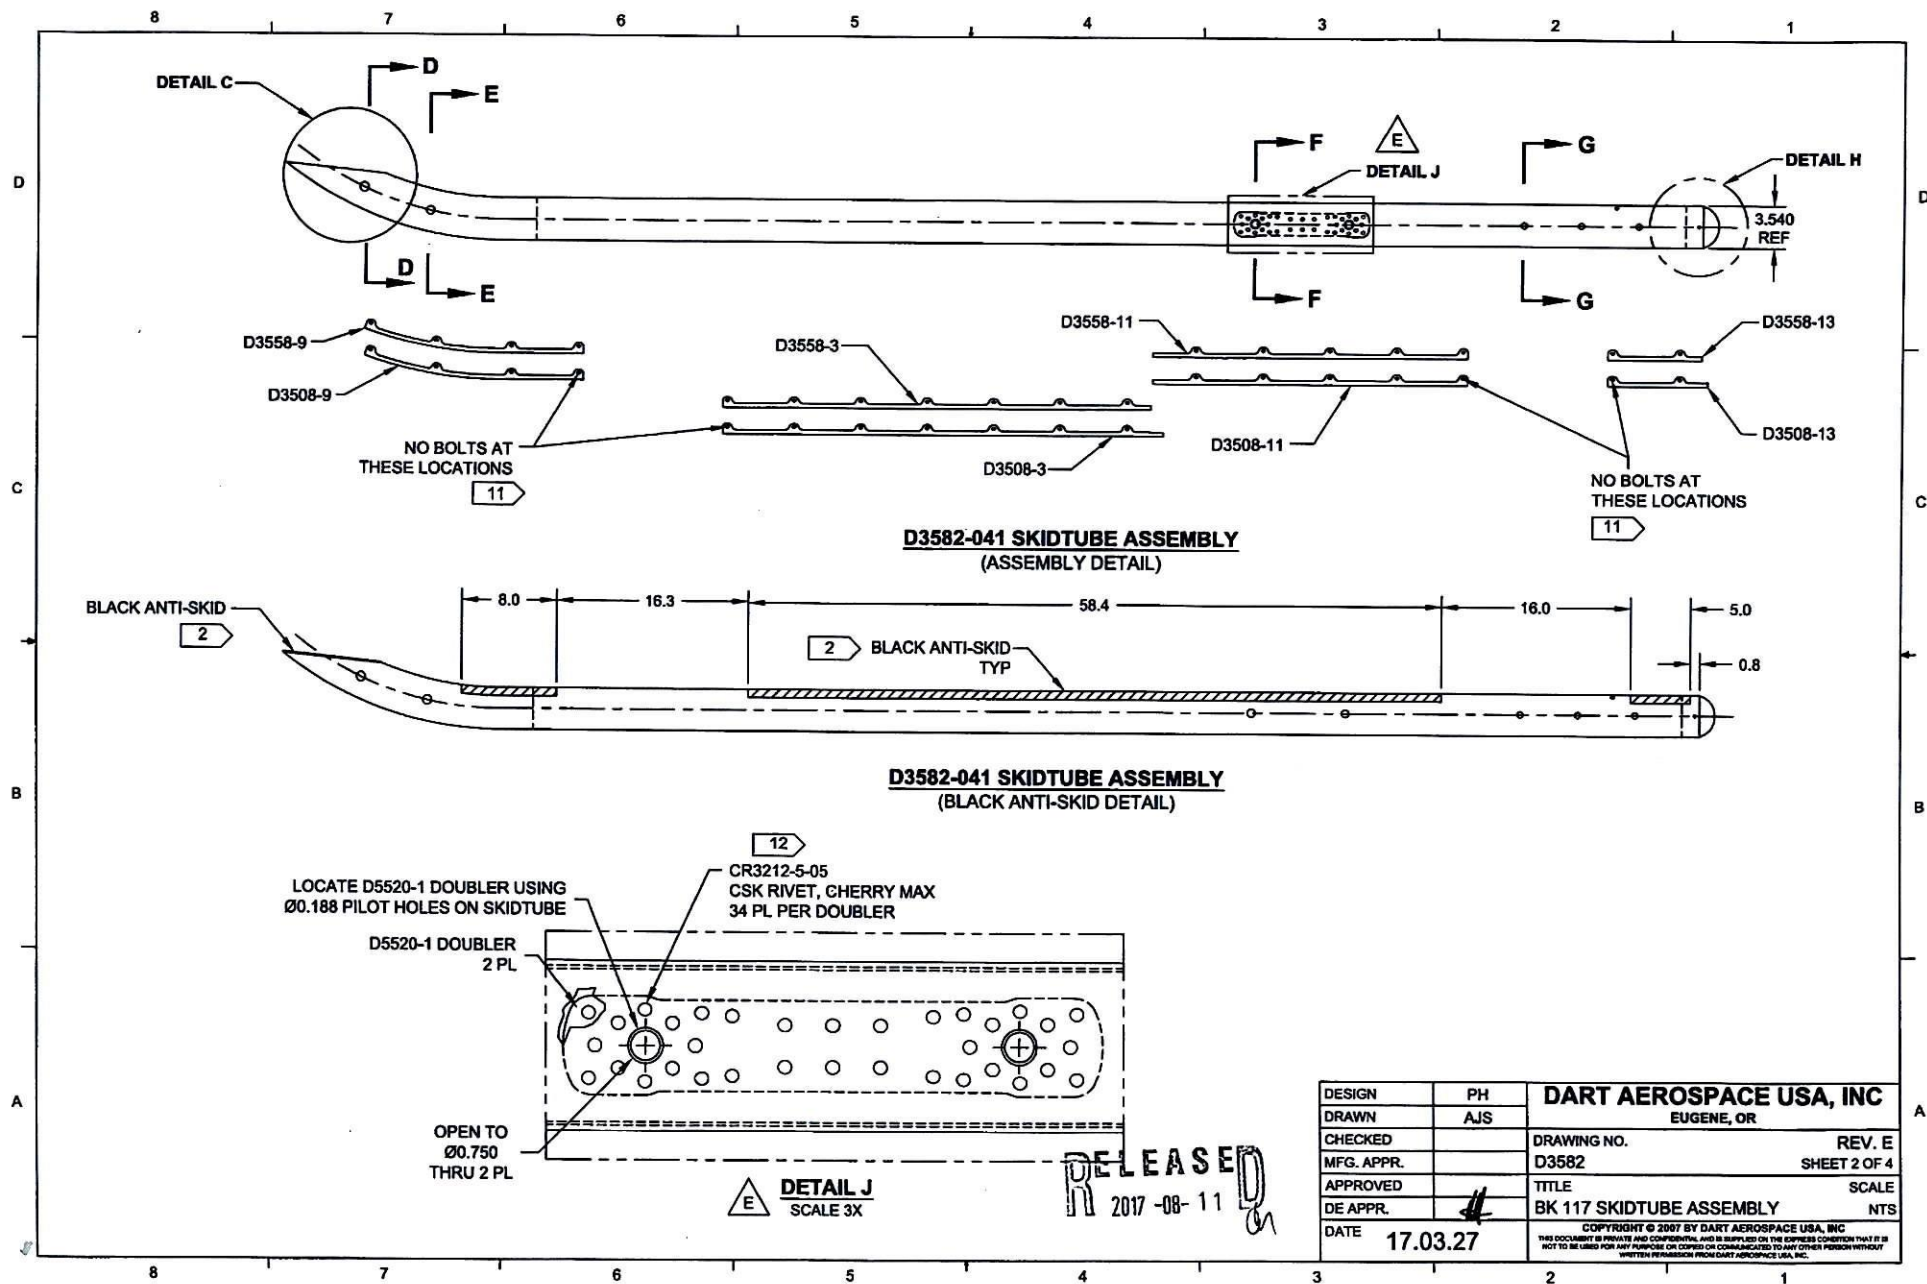

RELEASED
2017-08-11

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AJS	EUGENE, OR	
CHECKED		DRAWING NO.	REV. E
MFG. APPR.		D3582	SHEET 2 OF 4
APPROVED		TITLE	SCALE
DE APPR.		BK 117 SKIDTUBE ASSEMBLY	NTS
DATE	17.03.27	COPYRIGHT © 2007 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐


Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
								Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	OTHER : _____			

D2964 CAP
(GRIND FLUSH)

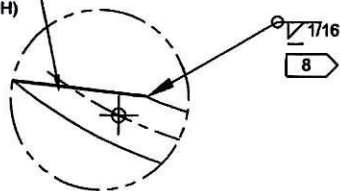

DETAIL C
SCALE 4X

D2971 SPACER

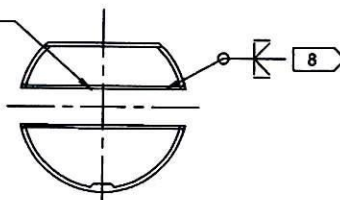


SECTION D-D
SCALE 4X

SECTION D-D NOTES

AFTER BENDING AND DRILLING ASSEMBLY
PERFORM THE FOLLOWING:

1. CHAMFER HOLE 0.030 x 45°
2. INSERT D2971 SPACER
3. WELD INTO PLACE AND GRIND FLUSH
4. PASS Ø0.750 DRILL TO REMOVE SPILL OVER

D3662-3 SPACER

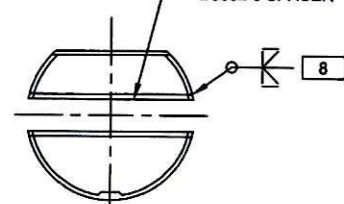


SECTION E-E
SCALE 4X

SECTION E-E NOTES

AFTER BENDING AND DRILLING ASSEMBLY
PERFORM THE FOLLOWING:

1. CHAMFER HOLE 0.030 x 45°
2. INSERT D3662-3 SPACER
3. WELD INTO PLACE AND GRIND FLUSH
4. PASS Ø0.672 DRILL TO REMOVE SPILL OVER

D5520-1 DOUBLER
REF

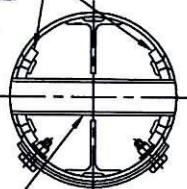

SECTION F-F
SCALE 4X
2 PL

SECTION F-F NOTES

AFTER BENDING AND DRILLING ASSY
PERFORM THE FOLLOWING:

1. INSERT D5304-1 SPACER
2. SWAGE TO Ø0.565 +0.005/-0.000 X 1.0
DEEP PER QSI 002
3. OPEN THRU HOLE TO Ø0.625
4. GRIND FLUSH

D3584-1 WEB
REF

D3662-1 SPACER
3 PL

10 AFTER FINISH, INSTALL
AELS-1032-130
INSERT 36 PL

AN3C4A BOLT (1)
NAS1149C0332R WASHER (1)
28 PL

10


SECTION G-G
SCALE 4X

SECTION G-G NOTES

AFTER BENDING AND DRILLING ASSEMBLY
PERFORM THE FOLLOWING:

1. CHAMFER HOLE 0.030 x 45°
2. INSERT D3662-1 SPACER (3 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. PASS Ø0.515 DRILL TO REMOVE SPILL OVER

AFTER FINISH, INSTALL
ALS7-428-165 INSERT (1)
AN4-4A BOLT (1)
NAS1149D0416J WASHER (1)
2 PL

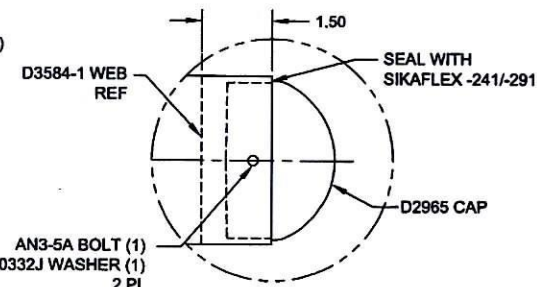

DETAIL H
SCALE 4X

AN3-5A BOLT (1)
NAS1149D0332J WASHER (1)
2 PL

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AJS	EUGENE, OR	
CHECKED		DRAWING NO.	REV. E
MFG. APPR.		D3582	SHEET 3 OF 4
APPROVED		TITLE	SCALE
DE APPR.		BK 117 SKIDTUBE ASSEMBLY	NTS
DATE	17.03.27	COPYRIGHT © 2007 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE, OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

RELEASED
2017-08-11

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coor. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐							
Date : _____		Step #: _____		QTY Effective : _____			MRB (QSI042) Approval				
Description Work Order Deviation				Disposition				Completed By			
Root Cause				FAULT CATEGORY							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐		No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐		Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐		Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐		Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	
OTHER : _____											

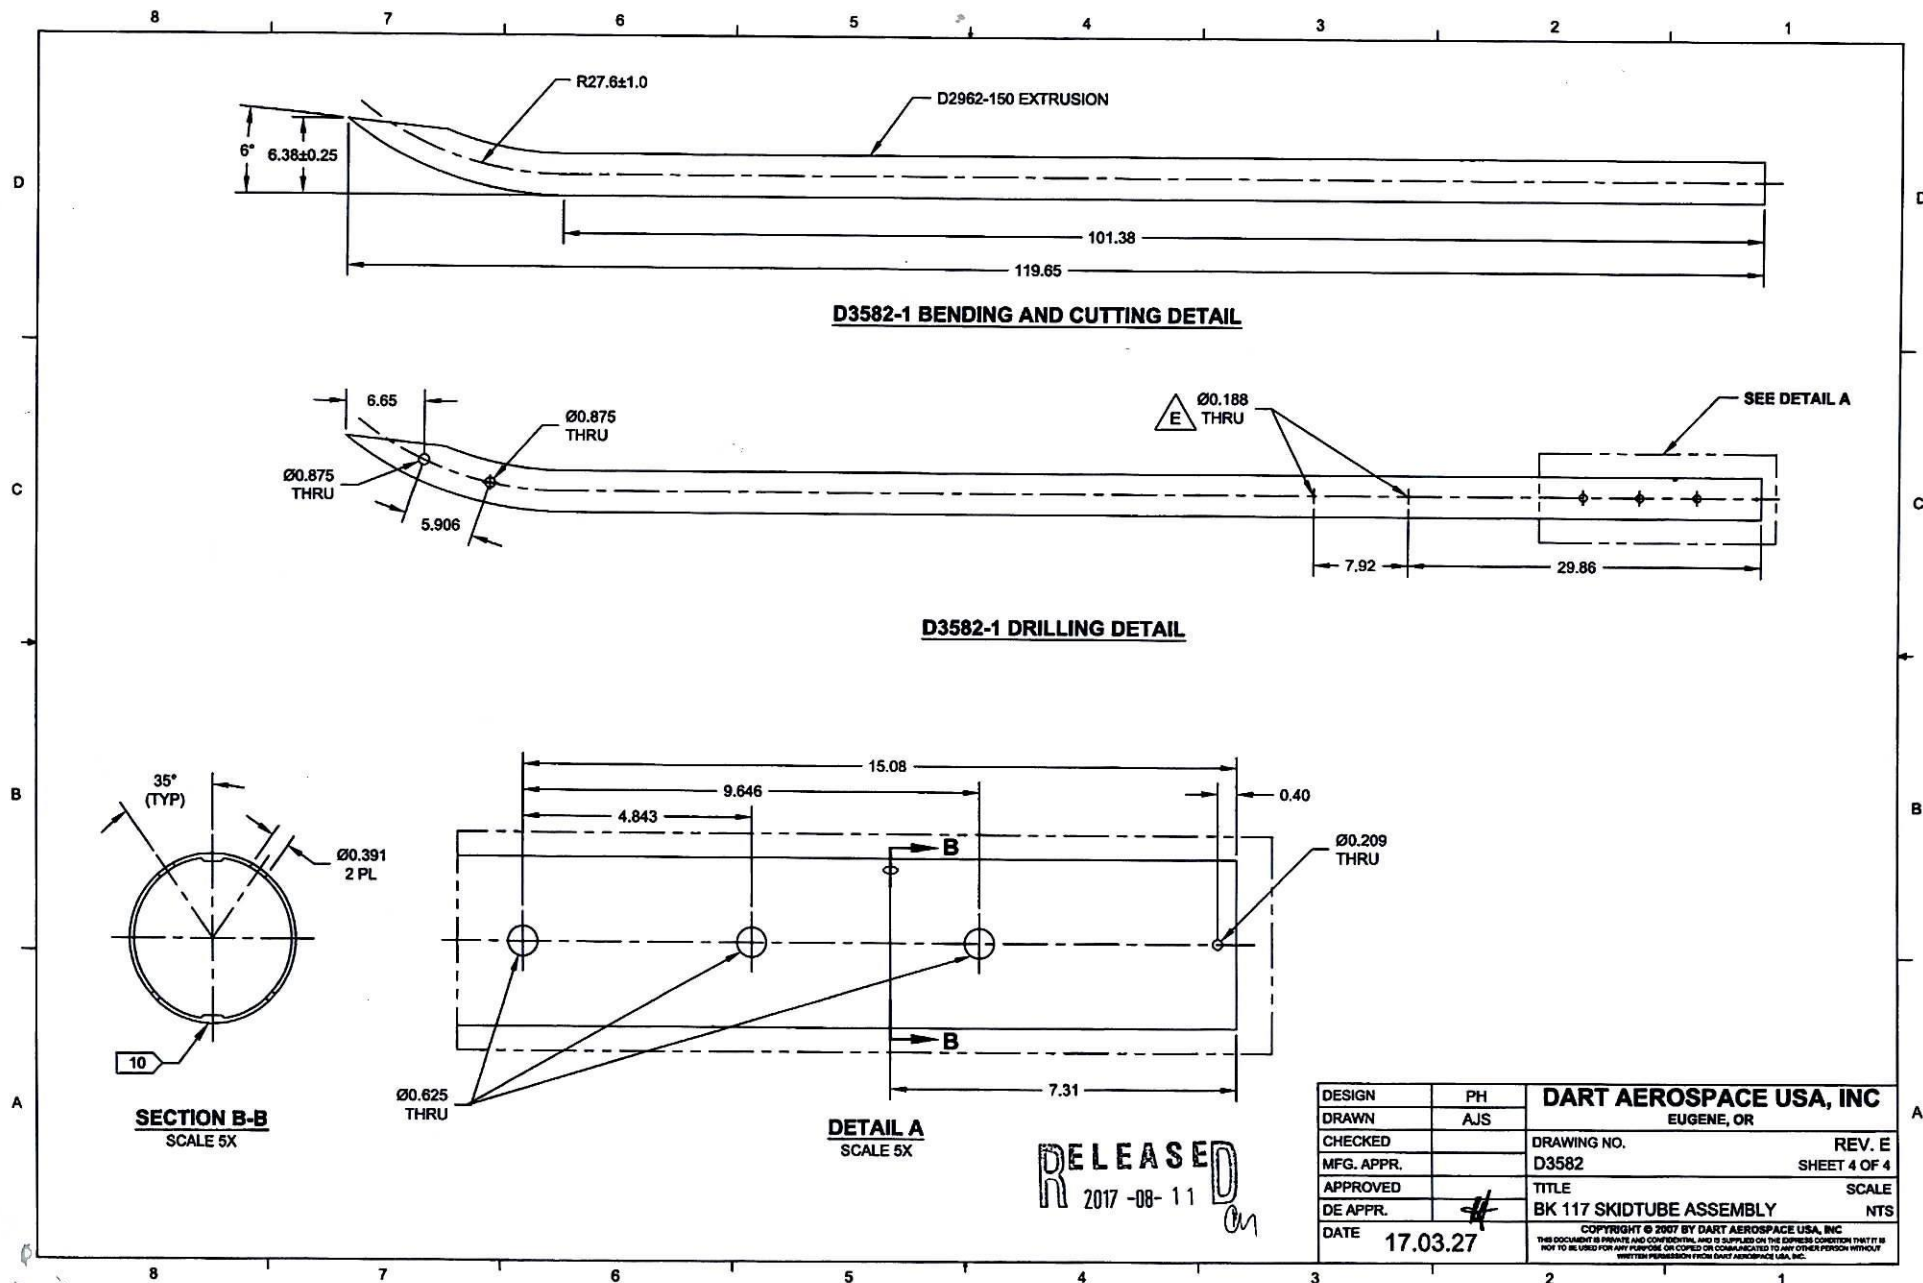

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AJS	EUGENE, OR	
CHECKED		DRAWING NO.	REV. E
MFG. APPR.		D3582	SHEET 4 OF 4
APPROVED		TITLE	SCALE
DE APPR.	#	BK 117 SKIDTUBE ASSEMBLY	NTS
DATE	17.03.27	COPYRIGHT © 2007 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE, OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>				Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐																																																
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																																																																	
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																																																																	
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																																																																	
Large Fab ☐	Composite ☐	Supplier ☐																																																																		
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval																																																																
Description Work Order Deviation		Disposition		Completed By																																																																
				Lead hand / Supervisor Approval Verification																																																																
				QC / QA Coordinator Approval																																																																
Root Cause		FAULT CATEGORY																																																																		
<table style="width:100%; border: none;"> <tr><td style="border: none;">Environment ☐</td><td style="border: none;">No Re-verification ☐</td></tr> <tr><td style="border: none;">Design ☐</td><td style="border: none;">Operator ☐</td></tr> <tr><td style="border: none;">Doc/Data ☐</td><td style="border: none;">Offset/Setup ☐</td></tr> <tr><td style="border: none;">Equip/Tooling ☐</td><td style="border: none;">Supplier ☐</td></tr> <tr><td style="border: none;">Handling/Pre ☐</td><td style="border: none;">Training ☐</td></tr> <tr><td style="border: none;">Material ☐</td><td style="border: none;">Use for Testing ☐</td></tr> <tr><td style="border: none;">Internal Transport ☐</td><td style="border: none;">Poor Information ☐</td></tr> <tr><td style="border: none;">Tribal Knowledge ☐</td><td style="border: none;">Rushing ☐</td></tr> <tr><td style="border: none;">LOA ☐</td><td style="border: none;">Product Improvement ☐</td></tr> <tr><td style="border: none;">Substation ☐</td><td style="border: none;">Process Improvement ☐</td></tr> <tr><td style="border: none;">Past Expiry Date ☐</td><td style="border: none;">Manufacturing Process ☐</td></tr> <tr><td style="border: none;">Misidentified ☐</td><td style="border: none;">Past Due ☐</td></tr> </table>	Environment ☐	No Re-verification ☐	Design ☐	Operator ☐	Doc/Data ☐	Offset/Setup ☐	Equip/Tooling ☐	Supplier ☐	Handling/Pre ☐	Training ☐	Material ☐	Use for Testing ☐	Internal Transport ☐	Poor Information ☐	Tribal Knowledge ☐	Rushing ☐	LOA ☐	Product Improvement ☐	Substation ☐	Process Improvement ☐	Past Expiry Date ☐	Manufacturing Process ☐	Misidentified ☐	Past Due ☐	<table style="width:100%; border: none;"> <tr><td style="border: none;">Pressure/Forced ☐</td></tr> <tr><td style="border: none;">Bending ☐</td></tr> <tr><td style="border: none;">Centre Not Concentric ☐</td></tr> <tr><td style="border: none;">Cracks ☐</td></tr> <tr><td style="border: none;">Crimp/Kink/Ripple/Wave ☐</td></tr> <tr><td style="border: none;">Cuffs ☐</td></tr> <tr><td style="border: none;">Crushing ☐</td></tr> <tr><td style="border: none;">Heat Treat ☐</td></tr> <tr><td style="border: none;">Wave/Twist in Tube ☐</td></tr> <tr><td style="border: none;">Marks/Chatter ☐</td></tr> </table>	Pressure/Forced ☐	Bending ☐	Centre Not Concentric ☐	Cracks ☐	Crimp/Kink/Ripple/Wave ☐	Cuffs ☐	Crushing ☐	Heat Treat ☐	Wave/Twist in Tube ☐	Marks/Chatter ☐	<table style="width:100%; border: none;"> <tr><td style="border: none;">Temperature/Cure ☐</td><td style="border: none;">Power Loss/Surge ☐</td><td style="border: none;">Positioned Wrong ☐</td></tr> <tr><td style="border: none;">Set-up ☐</td><td style="border: none;">Folio/Program ☐</td><td style="border: none;">Outside Dimensions ☐</td></tr> <tr><td style="border: none;">BOM/Route ☐</td><td style="border: none;">Grain ☐</td><td style="border: none;">Over/Under tolerance ☐</td></tr> <tr><td style="border: none;">Broken/Damage/Defect ☐</td><td style="border: none;">Weld ☐</td><td style="border: none;">Part Incorrect ☐</td></tr> <tr><td style="border: none;">Inspection Incomplete/Unqualified ☐</td><td style="border: none;">Wrong Stock Pulled ☐</td><td style="border: none;">Part Lost/Missing ☐</td></tr> <tr><td style="border: none;">Contamination ☐</td><td style="border: none;">Out of Sequence ☐</td><td style="border: none;">Part Moved ☐</td></tr> <tr><td style="border: none;">Countersink ☐</td><td style="border: none;">Off-set ☐</td><td style="border: none;">Drawing ☐</td></tr> <tr><td style="border: none;">Cut Too Short ☐</td><td style="border: none;">Mislabeled ☐</td><td style="border: none;">Finish ☐</td></tr> <tr><td style="border: none;">Instructions Incomplete/Unclear ☐</td><td style="border: none;">Fit/Function ☐</td><td style="border: none;">Misread ☐</td></tr> <tr><td style="border: none;">Drill Holes ☐</td><td style="border: none;">Misaligned/off center ☐</td><td style="border: none;">Turning Sequence ☐</td></tr> </table>			Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Countersink ☐	Off-set ☐	Drawing ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
Environment ☐	No Re-verification ☐																																																																			
Design ☐	Operator ☐																																																																			
Doc/Data ☐	Offset/Setup ☐																																																																			
Equip/Tooling ☐	Supplier ☐																																																																			
Handling/Pre ☐	Training ☐																																																																			
Material ☐	Use for Testing ☐																																																																			
Internal Transport ☐	Poor Information ☐																																																																			
Tribal Knowledge ☐	Rushing ☐																																																																			
LOA ☐	Product Improvement ☐																																																																			
Substation ☐	Process Improvement ☐																																																																			
Past Expiry Date ☐	Manufacturing Process ☐																																																																			
Misidentified ☐	Past Due ☐																																																																			
Pressure/Forced ☐																																																																				
Bending ☐																																																																				
Centre Not Concentric ☐																																																																				
Cracks ☐																																																																				
Crimp/Kink/Ripple/Wave ☐																																																																				
Cuffs ☐																																																																				
Crushing ☐																																																																				
Heat Treat ☐																																																																				
Wave/Twist in Tube ☐																																																																				
Marks/Chatter ☐																																																																				
Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐																																																																		
Set-up ☐	Folio/Program ☐	Outside Dimensions ☐																																																																		
BOM/Route ☐	Grain ☐	Over/Under tolerance ☐																																																																		
Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐																																																																		
Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐																																																																		
Contamination ☐	Out of Sequence ☐	Part Moved ☐																																																																		
Countersink ☐	Off-set ☐	Drawing ☐																																																																		
Cut Too Short ☐	Mislabeled ☐	Finish ☐																																																																		
Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐																																																																		
Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐																																																																		
OTHER : _____																																																																				